
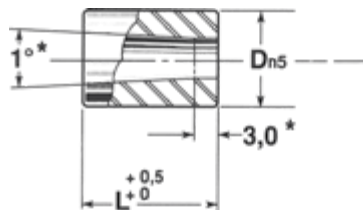


MATRYCE BEZ KOŁNIERZA
DIES-HEADLESS, TAPER RELIEF

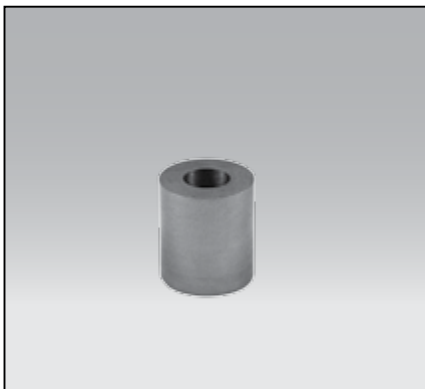


Mat.: M2
A2
HRC: 60-62

D	L				
	20	25	30	32	35
6,0	x	x			
8,0	x	x	x	x	
10,0	x	x	x	x	x
13,0	x	x	x	x	x
16,0	x	x	x	x	x
20,0	x	x	x	x	x
25,0	x	x	x	x	x
32,0	x	x	x	x	x
40,0	x	x	x	x	x

Przykład zamawiania:
Order example:

Mat.:	Nr kat. / Item no.	D	L		W	
A2	MFDH	13	x	32	x	5,0 SF4 @ 45°*

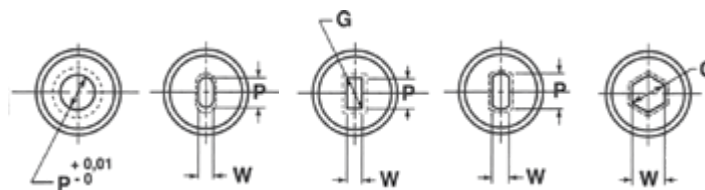

MFDC	MFDO		MFDR		MFDF		MFDH		D
	W & P= +/- 0,01								
P	Min W	Max P	Min P, W	Max G	Min W	Max G	Min W	Max P	
1,6-3,9	1,6	3,9	1,6	3,9	1,6	3,9	1,6	3,9	6,0
2,4-5,4	1,6	5,4	1,6	5,4	1,6	5,4	1,6	5,4	8,0
3,2-6,8	2,0	6,8	2,0	6,8	2,0	6,8	2,0	6,8	10,0
5,4-8,8	2,0	8,8	2,0	8,8	2,0	8,8	2,0	8,8	13,0
7,4-10,8	3,0	10,8	3,0	10,8	3,0	10,8	3,0	10,8	16,0
9,4-13,6	3,0	13,6	3,0	13,6	3,0	13,6	3,0	13,6	20,0
12,0-17,0	4,0	17,0	4,0	17,0	4,0	17,0	4,0	17,0	25,0
16,0-22,0	4,0	22,0	4,0	22,0	4,0	22,0	4,0	22,0	32,0
18,0-27,0	4,0	27,0	4,0	27,0	4,0	27,0	4,0	27,0	40,0

* Sposoby mocowania i lokalizacja na str. B/48.

* For key-flats and other locating methods, see page B/48.